CCTV

24VAC CCTV Power Supplies

EVP-1SA4PUL 4 Outputs @ 24VAC (4 Amps*)
EVP-1SA4P9UL 9 Outputs @24VAC (4Amps*)
EVP-1SA8P16UL 16 Outputs @24VAC (8 Amps*)

*Max total continuous output current, each channel output is fused at 1.1 Amp.

The ENFORCER CCTV Power Supplies centralize the power sources for multiple AC-powered CCTV cameras and/or CCTV accessories. The power input, power transformer, and all fused power outputs are enclosed in one heavy-duty, easy-to-install enclosure.



- Each output individually fused (PTC**- type fuses)
- Output fuses rated 1.1 Amps @ 250VAC
- Individual red LED status indicator for each output
- Main power switch to turn on/off power to outputs

Power

- Input: 110VAC, 60Hz. Output: 24VAC
- UL-approved power transformer
- Total output current:

4.0 Amps (EVP-1SA4P4UL, EVP-1SA4P9UL) 8.0 Amps (EVP-1SA8P16UL)

- Main fuse rated 5.0 Amps @ 250VAC
- Spare fuse and 6-foot power cord included

Enclosure

- Heavy-duty steel case to protect the power connections
- Removable steel cover for easy access to power connections
- Ventilation holes to prevent heat build-up
- Dimensions 10" x 7¾" x 3½"
- Knock-out on the cover for optional cam lock
- AC terminal block for easy connection from transformer to 6-foot power cord


Specifications:

	EVP-1SA4P4UL	EVP-1SA4P9UL	EVP-1SA8P16UL
Number of Outputs	4	9	16
Total Output Current	4 Amps*	4 Amps*	8 Amps*
Main Fuse Rating	5.0 Amps @ 250VAC		
Output Fuse Rating	1.1 Amps @ 250VAC		





Connections:

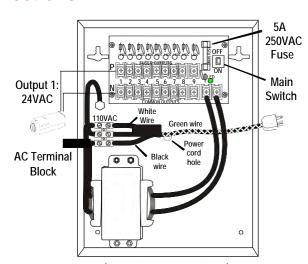

(EVP-1S4A4P9UL shown)

**PTC = Positive Temperature Coefficient

SECO-LARM® U.S.A., Inc.

16842 Millikan Avenue, Irvine, CA 92606 Phone: (949) 261-2999 | (800) 662-0800 Fax: (949) 261-7326

Website: www.seco-larm.com Email: sales@seco-larm.com

Copyright 2014 © SECO-LARM U.S.A., Inc. All rights reserved.
All trademarks are the property of SECO-LARM U.S.A., Inc. or their respective owners.
The SECO-LARM policy is one of continual development. For that reason, SECO-LARM reserves the right to change prices and specifications without notice. SECO-LARM is not responsible for misprints.